



SECTION 1: Identification of the substance/mixture and of the company/undertaking

1.1. Product identifier

Product form : Mixture
 Product name : Fiberglass - Polyester Skins/ Balsa Core Panels
 Product code : 101
 Other means of identification : Gillfloor 5007C Panel
 Gillfloor 5007D Panel
 Gillfloor 5018T Panel

1.2. Relevant identified uses of the substance or mixture and uses advised against

Use of the substance/mixture : Designed for use as flooring in cargo compartments and other high traffic areas.

1.3. Details of the supplier of the safety data sheet

The Gill Corporation
 4056 Easy Street
 El Monte, CA 91731
 (626) 443-4022
www.thegillcorp.com

1.4. Emergency telephone number

Emergency number : THE GILL CORPORATION: 1-626-443-4022 CHEMTREC: 1-800-424-9300

SECTION 2: Hazards identification

2.1. Classification of the substance or mixture

Classification(GHS-US)

Skin Sens. 1 H317
 Carc. 1B H350
 Repr. 2 H361
 Aquatic Acute 3 H402

Full text of H-phrases: see section 16

2.2. Label elements

GHS-US labeling

Hazard pictograms (GHS-US) :



GHS07

GHS08

Signal word (GHS-US) Hazard statements (GHS-US) :

Danger
 H317 - May cause an allergic skin reaction
 H350 - May cause cancer
 H361 - Suspected of damaging fertility or the unborn child
 H402 - Harmful to aquatic life

Precautionary statements (GHS-US) :

P201 - Obtain special instructions before use
 P202 - Do not handle until all safety precautions have been read and understood
 P261 - Avoid breathing dust/fume/gas/mist/vapors/spray
 P272 - Contaminated work clothing must not be allowed out of the workplace
 P273 - Avoid release to the environment
 P280 - Wear protective gloves, eye protection, protective clothing
 P302 + P352 - If on skin: Wash with plenty of water/...
 P308 + P313 - If exposed or concerned: Get medical advice/attention
 P321 - Specific treatment (see Section 4 on this label)
 P333+P313 - If skin irritation or rash occurs: Get medical advice/attention
 P362+P364 - Take off contaminated clothing and wash it before reuse
 P405 - Store locked up
 P501 - Dispose of contents/container to comply with local/regional/national/international regulations

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

2.3. Other hazards

Other hazards not contributing to the classification : As packaged, this material does not present significant health hazards. The hazards below apply to the product if aerosols or dusts are generated from cutting, grinding, or pulverizing.

2.4. Unknown acute toxicity (GHS-US)

Not applicable

SECTION 3: Composition/information on ingredients

3.1. Substance

Not applicable

3.2. Mixture

Name	Product identifier	%	Classification (GHS-US)
Balsa Wood	(CAS No) Not Available	4 - 60	Carc. 1B, H350
Fiberglass	(CAS No) 65997-17-3	10 - 50	Carc. 1B, H350
Cured polyester resin (containing styrene)	(CAS No) Not Available	18 - 50	Not classified
Zinc Borate	(CAS No) 138265-88-0	0.03 - 5	Eye Irrit. 2A, H319 Aquatic Acute 2, H401
Antimony Pentoxide	(CAS No) 1314-60-9	1 - 4	Not classified
Proprietary Adhesion reinforcement	(CAS No) Proprietary	0.8 - 2	AcuteTox. 4 (Inhalation:dust,mist), H332 Carc. 2, H351 Repr. 2, H361
Organic Phosphate Flame Retardant	(CAS No) Proprietary	0.3 - 0.5	Eye Irrit. 2A, H319 Skin Sens. 1, H317 Carc. 2, H351

Full text of H-phrases: see section 16

SECTION 4: First aid measures

4.1. Description of first aid measures

- First-aid measures general : Never give anything by mouth to an unconscious person. If you feel unwell, seek medical advice (show the label where possible).
- First-aid measures after inhalation : Get medical aid immediately. Remove from exposure and move to fresh air immediately. If not breathing, give artificial respiration. If breathing is difficult, give oxygen.
- First-aid measures after skin contact : Remove contaminated clothing. Rinse immediately with large amounts of water. If frostbite or freezing occurs, immediately flush with plenty of lukewarm water to GENTLY warm the affected area. Do not use hot water. Do not rub affected area. Get immediate medical attention. Obtain medical attention if irritation persists. DO NOT rub or scratch irritated area. If fiberglass becomes imbedded, seek medical attention.
- First-aid measures after eye contact : Flush immediately with large amounts of water for at least 15 minutes. Eyelids should be held away from the eyeball to ensure thorough rinsing. Get Immediate Medical Attention.
- First-aid measures after ingestion : Not expected to be an important route of entry into the body. If large amounts of particulate matter are ingested, it may cause gastrointestinal distress. Seek medical attention.

4.2. Most important symptoms and effects, both acute and delayed

- Symptoms/injuries : As packaged, this material does not present significant health hazards. The hazards below apply to the product if aerosols or dusts are generated from cutting, grinding, or pulverizing. Oxides from metallic fires are a severe health hazard. Inhalation or contact with substance or decomposition product may cause severe injury or death.
- Symptoms/injuries after inhalation : Product will act as a nuisance dust. Inhalation of high concentrations of dust may cause coughing and mild, transitory respiratory irritation.
- Symptoms/injuries after skin contact : Dusts and particulate matter may cause irritation of the skin.
- Symptoms/injuries after eye contact : Dusts and particulate matter may cause irritation of the eyes.
- Symptoms/injuries after ingestion : Not expected to be an important route of entry into the body. Ingestion of large quantities of the product may cause gastric discomfort or distress.
- Chronic symptoms : Persons with a history of chronic lung diseases may be at increased risk from exposure to excessive levels of nuisance dust. Persons with medical conditions generally aggravated by mechanical irritants in the air or on the skin may be at increased risk for a worsening of the underlying condition if exposed.

4.3. Indication of any immediate medical attention and special treatment needed

No additional information available

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 5: Firefighting measures

5.1. Extinguishing media

Suitable extinguishing media : Any. Use media appropriate for surrounding fire.

5.2. Special hazards arising from the substance or mixture

Fire hazard : Not flammable.

Reactivity : Not reactive under normal use and conditions.

5.3. Advice for firefighters

Protection during firefighting : Positive pressure self-contained breathing apparatus (SCBA) and structural firefighters' protective clothing will provide adequate protection.

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

General measures : Evacuate area.

6.1.1. For non-emergency personnel

Emergency procedures : Evacuate area.

6.1.2. For emergency responders

Protective equipment : Use personal protective equipment as required.

Emergency procedures : Keep unauthorized personnel away.

6.2. Environmental precautions

Avoid release to the environment.

6.3. Methods and material for containment and cleaning up

For containment Methods : Do not walk through any dust resulting from damage to product.

for cleaning up : Recover mechanically the product. Minimize generation of dust. HEPA Vacuum or wet methods and place in a disposal container.

SECTION 7: Handling and storage

7.1. Precautions for safe handling

Precautions for safe handling : Avoid contact with skin and eyes. Use methods to minimize dust. Do not breathe dust. DO NOT use compressed air or dry sweeping to remove dust from work area. Use a vacuum with adequate filtration system to remove dusts. If an appropriate vacuum is unavailable, only wet-clean-up methods should be used (i.e. misting). Moisture should be added as necessary to reduce exposure to airborne respirable silica dust.

Hygiene measures : Practice good housekeeping. Wash thoroughly after handling. Change contaminated clothing. Do not reuse until laundered. Separate working clothes from town clothes. Launder separately.

7.2. Conditions for safe storage, including any incompatibilities

Storage conditions : Store in a well-ventilated place. Keep container tightly closed.

Incompatible products : Strong acids, alkalis and oxidizers.

7.3. Specific end use(s)

Use of the substance/mixture : Designed for use as flooring in cargo compartments and other high traffic areas.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Fiberglass (65997-17-3)		
ACGIH	Not applicable	
OSHA	OSHA PEL (TWA) (mg/m ³)	3 fibers/cm ³ (fibers with diameter ≤ 3.5 μm & length ≥ 10 μm); 5 mg/m ³ TWA (total fibrous glass)

Cured polyester resin (containing styrene) (Not Available)

ACGIH	Not applicable	
OSHA	Not applicable	

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Antimony Pentoxide (1314-60-9)		
ACGIH	ACGIH TWA (mg/m ³)	0.5 mg/m ³
OSHA	OSHA PEL (TWA)(mg/m ³)	0.5 mg/m ³

Zinc Borate (138265-88-0) Particulates Not Otherwise Regulated		
ACGIH	Not applicable	
OSHA	Not applicable	

Balsa Wood (Not Available) Particulates Not Otherwise Regulated		
ACGIH	Not applicable	
OSHA	Not applicable	

Proprietary Adhesion reinforcement (Not Available) Particulates Not Otherwise Regulated		
ACGIH	Not applicable	
OSHA	Not applicable	

Organic Phosphate Flame Retardant (Not Available) Particulates Not Otherwise Regulated		
ACGIH	Not applicable	
OSHA	Not applicable	

Styrene (100-42-5)		
ACGIH	ACGIH TWA (ppm)	20 ppm
ACGIH	ACGIH STEL (ppm)	40 ppm
ACGIH	Remark (ACGIH)	CNS impair; URT irr; peripheral
OSHA	OSHA PEL (TWA) (ppm)	100 ppm
OSHA	Remark (OSHA)	(2) See Table Z-2.
IDLH	US IDLH (ppm)	700 ppm

Particulates Not Otherwise Regulated (Total Dust)		
ACGIH	ACGIH TWA (mg/m ³)	3 mg/m ³ Respirable; 10 mg/m ³ Total dust
OSHA	OSHA PEL (TWA)(mg/m ³)	5mg/m ³ Respirable; 15 mg/m ³ Total dust

8.2. Exposure controls

Appropriate engineering controls	: Emergency eye wash fountains and safety showers should be available in the immediate vicinity of any potential exposure. Enclosed processes used in combination with local exhaust ventilation as necessary to control air contaminants at or below acceptable exposure guidelines. Collection systems must be designed and maintained to prevent the accumulation and recirculation of respirable silica into the workplace.
Hand protection	: None normally needed. Impervious gloves may be used to prevent mechanical irritation.
Eye protection	: Where eye contact is possible with particulate matter, safety glasses with side shields are recommended.
Skin and body protection	: Depending on the risk, wear a tight, long apron and boots or suitable chemical protection clothing. Nitrile rubber or similar protections are recommended for waste clear-up and manufacturing operations.
Respiratory protection	: Follow NIOSH recommendations for respirator use if welding, cutting, or grinding.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Solid
Appearance	: Flat, Textured
Color	: White; Off-white
Odor	: None
Odor threshold	: No data available

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

pH	: No data available
Relative evaporation rate (butyl acetate=1)	: No data available
Melting point	: No data available
Freezing point	: No data available
Boiling point	: No data available
Flash point	: No data available
Auto-ignition temperature	: No data available
Decomposition temperature	: No data available
Flammability (solid, gas)	: No data available
Vapor pressure	: No data available
Relative vapor density at 20 °C	: No data available
Relative density	: 0.28-1.0 g/cc
Solubility	: Insoluble in water
Log Pow	: No data available
Log Kow	: No data available
Viscosity, kinematic	: No data available
Viscosity, dynamic	: No data available
Explosive properties	: No data available
Oxidizing properties	: No data available
Explosive limits	: No data available

9.2. Other information

No additional information available

SECTION 10: Stability and reactivity

10.1. Reactivity

Not reactive under normal use and conditions.

10.2. Chemical stability

Stable under normal conditions.

10.3. Possibility of hazardous reactions

Hazardous polymerization will not occur.

10.4. Conditions to avoid

No additional information available

10.5. Incompatible materials

Strong oxidizing agents, strong acids and bases, especially oxalic and hydrofluoric acid and acyl halides.

10.6. Hazardous decomposition products

CO, CO₂, various low molecular weight hydrocarbons, oxides of phosphorus, biphenyl, organic acids and other toxic gases, acrid smoke, and fumes. Flammable gases and vapors may also be produced during thermal decomposition.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity : Not classified

Proprietary Adhesion reinforcement

ATE US (dust, mist)	1.500 mg/l/4h
---------------------	---------------

Skin corrosion/irritation	: Not classified
Serious eye damage/irritation	: Not classified
Respiratory or skin sensitization	: May cause an allergic skin reaction.
Germ cell mutagenicity	: Not classified
Carcinogenicity	: May cause cancer.

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Styrene (100-42-5)	
IARC group	2B - Possibly carcinogenic to humans
National Toxicology Program (NTP) Status	3 - Reasonably anticipated to be Human Carcinogen

Fiberglass (65997-17-3)	
IARC group	3 - Not classifiable
National Toxicology Program (NTP) Status	3 - Reasonably anticipated to be Human Carcinogen

Reproductive toxicity	: Suspected of damaging fertility or the unborn child.
Specific target organ toxicity (single exposure)	: Not classified
Specific target organ toxicity (repeated exposure)	: Not classified
Aspiration hazard	: Not classified
Symptoms/injuries after inhalation	: Product will act as a nuisance dust. Inhalation of high concentrations of dust may cause coughing and mild, transitory respiratory irritation.
Symptoms/injuries after skin contact	: Dusts and particulate matter may cause irritation of the skin.
Symptoms/injuries after eye contact	: Dusts and particulate matter may cause irritation of the eyes.
Symptoms/injuries after ingestion	: Not expected to be an important route of entry into the body. Ingestion of large quantities of the product may cause gastric discomfort or distress.
Chronic symptoms	: Persons with a history of chronic lung diseases may be at increased risk from exposure to excessive levels of nuisance dust. Persons with medical conditions generally aggravated by mechanical irritants in the air or on the skin may be at increased risk for a worsening of the underlying condition if exposed.

SECTION 12: Ecological information

12.1. Toxicity

Zinc Borate (138265-88-0)	
LC50 fish	335 mg/l Bluegill
LC50 fish	2.7 mg/l Rainbow Trout

12.2. Persistence and degradability

No additional information available

12.3. Bioaccumulative potential

No additional information available

12.4. Mobility in soil

No additional information available

12.5. Other adverse effects

Effect on the global warming : No known ecological damage caused by this product.

SECTION 13: Disposal considerations

13.1. Waste treatment methods

Waste disposal recommendations : Recover or recycle if possible. Dispose in a safe manner in accordance with local/national regulations.

SECTION 14: Transport information

In accordance with DOT

Not regulated for transport

Additional information

Other information : No supplementary information available.

ADR

No additional information available

Transport by sea

No additional information available

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Air transport

No additional information available

SECTION 15: Regulatory information

15.1. US Federal regulations

Fiberglass - Polyester Skins/ Balsa Core Panels

Not listed on the United States TSCA (Toxic Substances Control Act) inventory

Fiberglass (65997-17-3)

Listed on the United States TSCA (Toxic Substances Control Act) inventory

Zinc Borate (138265-88-0)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on United States SARA Section 313

RQ (Reportable quantity, section 304 of EPA's List of Lists) :	1000 lb
--	---------

Cured polyester resin (containing styrene) (Not Available)

Not listed on the United States TSCA (Toxic Substances Control Act) inventory

Antimony Pentoxide (1314-60-9)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on United States SARA Section 313

Styrene (100-42-5)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Subject to reporting requirements of United States SARA Section 313

CERCLA RQ	1000 lb
-----------	---------

15.2. International regulations

CANADA

No additional information available

EU-Regulations

No additional information available

Classification according to Regulation (EC) No. 1272/2008 [CLP]

Classification according to Directive 67/548/EEC [DSD] or 1999/45/EC [DPD]

Not classified

15.2.2. National regulations

Styrene (100-42-5)

Listed on IARC (International Agency for Research on Cancer)
Listed as carcinogen on NTP (National Toxicology Program)

15.3. US State regulations

Fiberglass (65997-17-3)

U.S. - California - Proposition 65 - Carcinogens List	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
Yes	No	No	No	

Styrene (100-42-5)

U.S. - California - Proposition 65 - Carcinogens List	U.S. - California - Proposition 65 - Developmental Toxicity	U.S. - California - Proposition 65 - Reproductive Toxicity - Female	U.S. - California - Proposition 65 - Reproductive Toxicity - Male	No significance risk level (NSRL)
Yes	No	No	No	27 µg per day

Fiberglass - Polyester Skins/Balsa Core Panels

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Styrene (100-42-5)

U.S. - Idaho - Non-Carcinogenic Toxic Air Pollutants - Acceptable Ambient Concentrations
U.S. - Maine - Air Pollutants - Hazardous Air Pollutants
U.S. - Massachusetts - Right To Know List
U.S. - Michigan - Critical Materials List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - New York - Reporting of Releases Part 597 - List of Hazardous Substances
U.S. - Pennsylvania - RTK (Right to Know) List

Antimony Pentoxide (1314-60-9)

U.S. - Massachusetts - Right To Know List
U.S. - New Jersey - Right to Know Hazardous Substance List
U.S. - New York - Reporting of Releases Part 597 - List of Hazardous Substances
U.S. - Pennsylvania - RTK (Right to Know) List

Zinc Borate (138265-88-0)

U.S. - Delaware - Pollutant Discharge Requirements - Reportable Quantities
U.S. - Massachusetts - Right To Know List
U.S. - New York - Reporting of Releases Part 597 - List of Hazardous Substances
U.S. - Pennsylvania - RTK (Right to Know) List

SECTION 16: Other information

Revision date : 07/26/2024
Data sources : ChemADVISOR, Inc.[<https://www.chemadvisor.com>]. GESTIS DNEL Database [[http://dnel-en.itrust.de/nxt/gateway.dll/dnel_en/000000.xml?f=templates\\$fn=default.htm\\$vid=dneleng.ddb_eng\\$3.0/](http://dnel-en.itrust.de/nxt/gateway.dll/dnel_en/000000.xml?f=templates$fn=default.htm$vid=dneleng.ddb_eng$3.0/)].


Full text of H-phrases:

Acute Tox. 4 (Inhalation:dust,mist)	Acute toxicity (inhalation:dust,mist) Category 4
Aquatic Acute 2	Hazardous to the aquatic environment - Acute Hazard Category 2
Aquatic Acute 3	Hazardous to the aquatic environment - Acute Hazard Category 3
Carc. 1B	Carcinogenicity Category 1B
Carc. 2	Carcinogenicity Category 2
Eye Irrit. 2A	Serious eye damage/eye irritation Category 2A
Repr. 2	Reproductive toxicity Category 2
Skin Sens. 1	Skin sensitization Category 1
H317	May cause an allergic skin reaction
H319	Causes serious eye irritation
H332	Harmful if inhaled
H335	May cause respiratory irritation
H350	May cause cancer
H351	Suspected of causing cancer
H361	Suspected of damaging fertility or the unborn child
H401	Toxic to aquatic life
H402	Harmful to aquatic life

NFPA health hazard : 2 - Intense or continued exposure could cause temporary incapacitation or possible residual injury unless prompt medical attention is given.

NFPA fire hazard : 0 - Materials that will not burn.

NFPA reactivity : 0 - Normally stable, even under fire exposure conditions, and are not reactive with water.

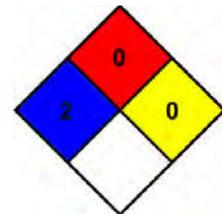

HMIS III Rating

Health : * Chronic Hazard - Chronic (long-term) health effects may result from repeated overexposure

Flammability : 0 Minimal Hazard

Physical : 0 Minimal Hazard

SDS US (GHS HazCom 2012)

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product.